

Designer r30.8.3 Release Notes

r30.8.3 - Hotfixes

[Download r30.8.3 Full \(Pro\)](#)

Full (Pro) build: 218797

Starter build: 218798

Released: May 28th 2025

Fixes

- **DSOF-30362** - When transitioning in to a new section after holding at the end Designer will no longer occasionally play a single frame from the middle of the upcoming video.
- **DSOF-30341** - Video layers in quantized tracks now play back at the correct speed.
- **DSOF-30232** - In certain hardware configurations machines with a Matrox capture card will no longer intermittently drop frames on input.
- **DSOF-30306** - Specific projects will no longer report an exception on shutdown.
- **DSOF-28645** - EX range understudies can now be used to understudy an EX range Dedicated Director even if the actors are non-EX range machines without reporting an error.
- **DSOF-30281** - Receiving anomalous timecode while chasing will now never put Designer in to "Ignoring Timecode" mode.
- **DSOF-30234** - Projectors that are renamed before a machine CTDs will no longer be corrupted when the project is re-opened.
- **DSOF-30363** - EventTransportDMX Brightness is no longer sent every frame if it's not changing.
- **DSOF-30297** - Machines that fail to properly release certain telemetry files no longer fill up their memory with temp copies of those files.